

YEAR
1991

MODEL
LEGEND
With A/T

VIN APPLICATION
See VEHICLES
AFFECTED

BULLETIN NO.
91-007



Buzzing Noise From The Muffler

(Supersedes 91-007, dated January 28, 1991)

SYMPTOM

The customer may complain about a buzzing noise that is audible around 2,300 rpm. The noise is similar to a loose heat shield, occurs while accelerating under a moderate load, and is most noticeable after the muffler warms up.

PROBABLE CAUSE

A loose separator plate inside the muffler.

VEHICLES AFFECTED

NEW

Coupe: All up to VIN: JH4KA8...MC000533

Sedan: All up to VIN: JH4KA7...MC016579

CORRECTIVE ACTION

Replace the muffler, using the procedure on page 9-4 in the Service Manual, with the new muffler listed under PARTS INFORMATION.

PARTS INFORMATION

Muffler - Automatic Trans: 18307-SP0-013

Gasket (1): 18303-SP0-003

Self-Locking Nuts (3): 90115-659-003

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager or your Zone Office. You must request consideration, and get the DSM's decision, before starting work.

Operation number: 311170

Flat rate time: 0.4 hour

Failed P/N: 18307-SP0-003

Defect code: 061

Contention code: B07