



Buzzing From the Seat Belt Shoulder Anchor

SYMPTOM

A buzzing noise coming from the upper part of the B pillar when driving on rough roads.


PROBABLE CAUSE

The plastic cover on the seat belt shoulder anchor is contacting the seat belt track.


CORRECTIVE ACTION

Cushion the seat belt track cover with wool felt (see REQUIRED MATERIALS).

1. Remove the front and rear door trim along the upper half of the B pillar.
2. Remove the anchor cover and the seat belt anchor bolt.
3. Pull the top of the B pillar upper trim away from the body so you can access the seat belt track cover. You do not need to completely remove the trim piece.

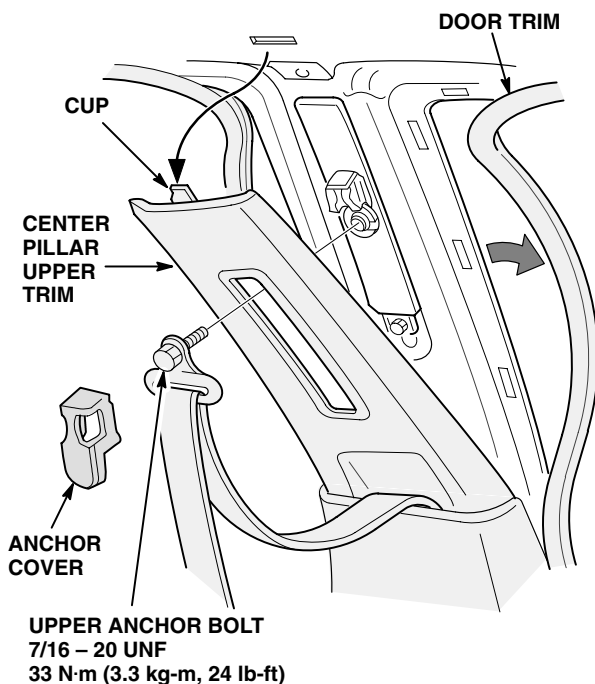

4. Cut four 6 mm wide pieces of wool felt. Apply them to the track cover between the cover and the track.

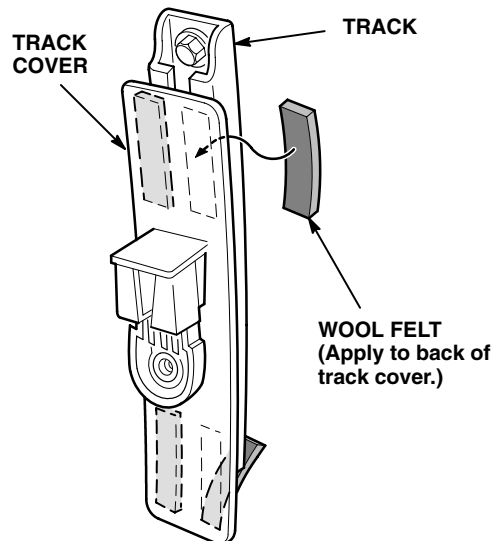

5. Reinstall all removed parts.

REQUIRED MATERIALS

Wool felt: P/N 06993-SA5-000

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Technical Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

Operation number: 854205 - Left side
864205 - Right side

Flat rate time: 0.4 hour per side

Failed P/N: 81460-SP0-004ZA

Defect code: 043

Contention code: B07