

YEAR
1991 - 92

MODEL
LEGEND 4-DOOR

VIN APPLICATION
ALL

BULLETIN NO.
92-025



Rear Side Window Molding End Cap Replacement

SYMPTOM

The rear side window (C pillar) molding end caps are missing or loose.


PROBABLE CAUSE

The adhesive between the end cap and the molding has hardened and disintegrated.

CORRECTIVE ACTION

Reattach or replace both end caps.

1. Remove caps if necessary.
2. Dampen a cloth with Contact Cleaner (P/N TB-SP-270TA).
Clean the inside of the C pillar molding and the painted surface just below it.
3. Apply Weatherstrip Cement (P/N 08712-0002), or equivalent, to the front and back sides of the end cap.

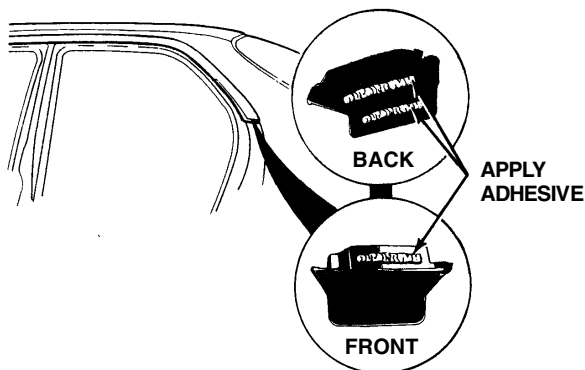

4. Install molding end caps.

PARTS INFORMATION

End cap, molding right P/N 72920-SP0-999
End cap, molding left P/N 72960-SP0-999

WARRANTY INFORMATION

In warranty: The normal warranty applies.

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager. You must request consideration, and get the DSM's decision, before starting work.

Operation number: 837200
Flat rate time: 0.2 hour
Failed P/N: 72920-SP0-999
Defect code: 025
Contention code: A02