

YEAR  
1991

MODEL  
LEGEND  
COUPE

VIN APPLICATION  
Through VIN  
JH4KA8...MC005366

BULLETIN NO.  
91-039



## Popping Noise from the Front Window Regulator

### SYMPTOM

A popping noise coming from the front door when the window is raised.


### PROBABLE CAUSE

A plastic washer on the window regulator obstructs the regulator movement. When the regulator overcomes the washer's resistance it makes a popping noise.

### CORRECTIVE ACTION

Remove the plastic washer from the window regulator as follows:

1. Lower the window with the affected regulator until there is 45 - 50 mm of the window showing.

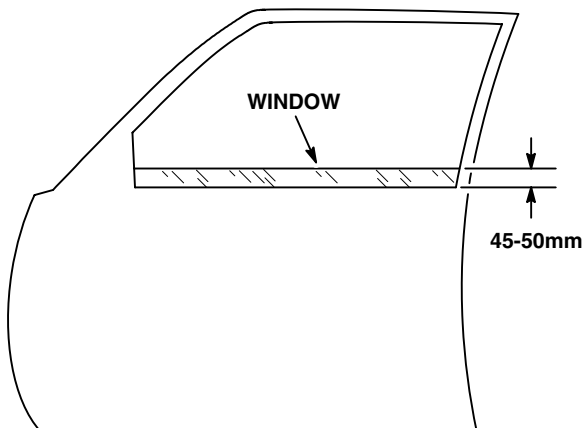


2. Remove the door panel to gain access to the affected window regulator. (Refer to door panel/plastic cover replacement procedure in Section 20 page 4 of the service manual).

3. Using a soldering gun with a plastic cutting tip, make a cut through the washer on the regulator arm as shown.

#### NOTICE

Use care when cutting the washer to not damage the slider with the plastic cutting tip.

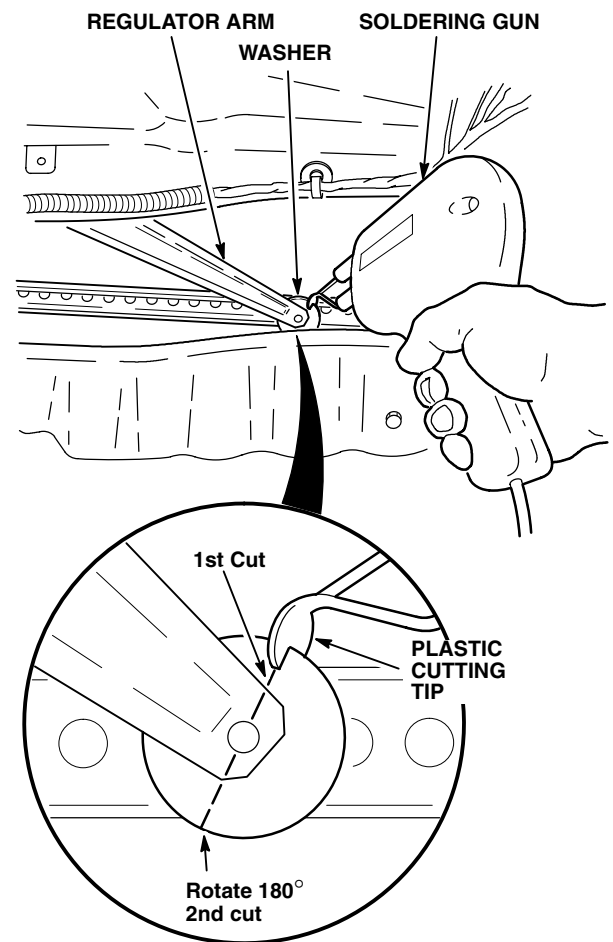

4. Rotate the washer 180° and make another cut through the washer with the plastic cutting tip. Remove the washer from the regulator.
5. Lubricate the sliding surfaces of the window regulator with grease.
6. Reconnect the door panel switches and check the power window, door lock and security system for operation. Once all operations are checked, reinstall the door panel.

## WARRANTY INFORMATION

**In warranty:** The normal warranty applies.

**Out-of-warranty:** Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager. You must request consideration, and get the DSM's decision, before starting work.

Operation number: 826025 - Left door  
827025 - Right door

Flat rate time: 0.5

Failed P/N: 72211-SP1-J01

Defect code: 042

Contention code: B07