

June 29, 1992

YEAR 1991-92 MODEL **LEGEND** 

VIN APPLICATION
See VEHICLES
AFFECTED

92-016

- + BODY

# **Seat Memory Beeps or Fails to Recall**

## **SYMPTOMS**

When a seat position is recalled:

- 1. The seat memory beeps twenty times.
- 2. The seat does not move, or moves to the wrong position.

# **PROBABLE CAUSE**

The number of pulses required to recall the seat position exceeded the control unit's memory capacity, causing it to lose the memorized position.

#### **VEHICLES AFFECTED**


1991: All

1992 Sedan: thru VIN JH4KA7 . . . NC020994 1992 Coupe: thru VIN JH4KA8 . . . NC002652

## **CORRECTIVE ACTION**

Replace the power seat control unit with the appropriate updated unit listed under PARTS INFORMATION.

- 1. Move the seat backward. Remove the front seat track covers and mounting bolts.
- 2. Move the seat forward. Remove the rear seat track covers and mounting bolts.
- 3. Lift the front of the seat and support it with a 10 in. long piece of wood.
- 4. Remove the two mounting screws and the front cover
- 5. Remove the slide joint cable.

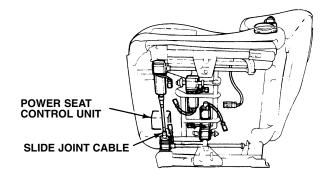

- Remove the four mounting bolts for the control unit. Disconnect the three electrical connectors and remove the control unit.
- Connect the electrical connectors to the new control unit. Mount the control unit with the original bolts, tighten them securely.
- 8. Reinstall the slide joint cable and the front cover.
- 9. Install the four seat track mounting bolts, tighten them to 35 N·m (3.4 kg-m, 25 lb-ft). Install the seat track covers.
- Move the seat bottom and seat-back through their full ranges to make sure they do not bind.

#### PARTS INFORMATION

Power seat control unit:

Sedan 81228-SP0-H01RM Coupe 81228-SP1-H01RM

# **WARRANTY CLAIM INFORMATION**

In warranty: The normal warranty applies.

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager. You must request consideration, and get the DSM's decision, before starting work.

Operation number: 749140 Flat rate time: 0.7 hr

Failed P/N: 81228-SP0-003

Defect code:

Beeps 20 times: 066 Fails to recall: 072 Contention code: B01