

NEW

YEAR
1991 – 93
1994

MODEL
LEGEND
INTEGRA

VIN APPLICATION
See VEHICLES
AFFECTED

BULLETIN NO.
92-026



Glove Box Light Stays On

(Supersedes 92-026, dated September 15, 1992)

SYMPTOM

The glove box light stays on when the glove box lid is closed. This is noticeable at night when the headlights are on and the inside of the car is dark; you can see a glow around the glove box lid.

PROBABLE CAUSE

The glove box switch plunger is too short.

VEHICLES AFFECTED


LEGEND: All 1991 – 93

INTEGRA 1994 3-door
GS-R: Thru VIN JH4DC2...RS001075
LS: Thru VIN JH4DC4...RS009083

CORRECTIVE ACTION

Install the glove box tube cap listed under PARTS INFORMATION to lengthen the switch plunger.

1. Using a sharp utility knife, shorten the glove box tube cap to 12 mm.
2. Press the tube cap over the glove box switch plunger.

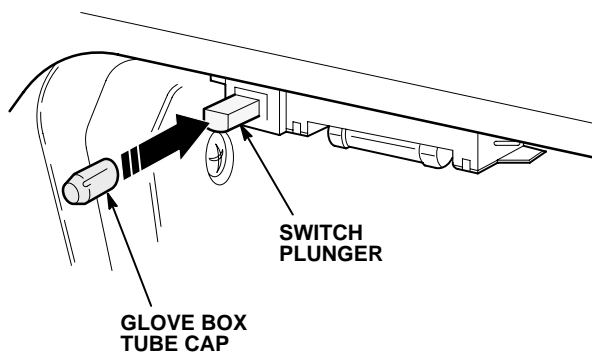

3. Turn the headlights on, and confirm that the glove box light goes off when the glove box lid is closed.

PARTS INFORMATION

Glove Box Tube Cap: P/N 34254-SP0-308 **NEW**

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

Operation number: 715010

Flat rate time: 0.2 hour

Failed P/N: 34254-SP0-A03 Legend

34254-SM4-013 Integra **NEW**

Defect code: 066

Contention code: B03